


MONUMENT ACCESSORIES			
Other survey grade monuments that were located in the vicinity and their relation to the monument. Geodetic coordinates in this table are provided in the format Easting, Northing.			
ID	BEARING	DIST.	DESCRIPTION
(#10107)	N 89d15'50" E	60.95'	3126176.60, 1426870.18 Stone found at Per_W01, the North $\frac{1}{4}$ Corner of Section 01-T08N-R01W, Perry Township
(#10272)	N 63d7'23" E	32.71'	3126144.82, 1426884.19 Cut + in the south top of the last guardrail post to the east
(#10274)	S 27d34'35" E	11.12'	3126120.80, 1426859.54 Cut + found on the northwest corner of 3'x3' concrete traffic signal pole base
(#10276)	S 61d23'55" W	89.50'	3126037.07, 1426826.56 Cut + on the southeast corner of 3'x3' concrete traffic signal pole base
(#10278)	N 56d2'14" W	96.73'	3126035.42, 1426923.44 Cut + in the southeast rim of 3.1'x1.45' storm inlet in the east side of the concrete drive entrance to Bruster's and Loren Wood Builders
(#10280)	N 27d56'30" W	78.39'	3126078.92, 1426938.65 Cut + on the southwest corner of 3'x3' concrete traffic signal pole base

NOTES:



- Field work was performed on 03/21/2018 and 10/11/2018.
- Monroe County Surveyor's Field Book 51, page 47 and Field Book 52, page 50.
- Project Name: INDOT Network 2018, Field work by: RSO & ERS, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
- The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover.
- Vicinity sketch was compiled per 2014 aerial photography.
- There was formerly a railroad spike at this corner, which was witnessed by the Monroe County Surveyor, Kevin Enright, on March 30, 2009 and accepted by the Monroe County Surveyor Review Board on May 12, 2009. The railroad spike was replaced by INDOT with a standard INDOT section corner monument as part of a prior resurfacing project on State Road 446. Historic research has not yet been performed to prove the validity of this monument.

▲ **Monument Description:** 1" iron pin found flush in 6" diameter concrete (there is also a mag nail next to the pin)

State Plane Grid Coordinates: Point No.:10116 Northing: 1426869.4', Easting: 3126115.6'

SHEET 1 OF 2	MONUMENT RECORD	South 1/4 Corner	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph <i>Monroe County Surveyor</i> Rachel Savich Oser <i>Professional Surveyor</i> 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
	CORNER ID: Blm_W25	Section 36- T09N-R01W Bloomington Township Monroe County, Indiana	

Photos were taken on 03/21/2018 with an iPhone 6s and on 3/30/2009

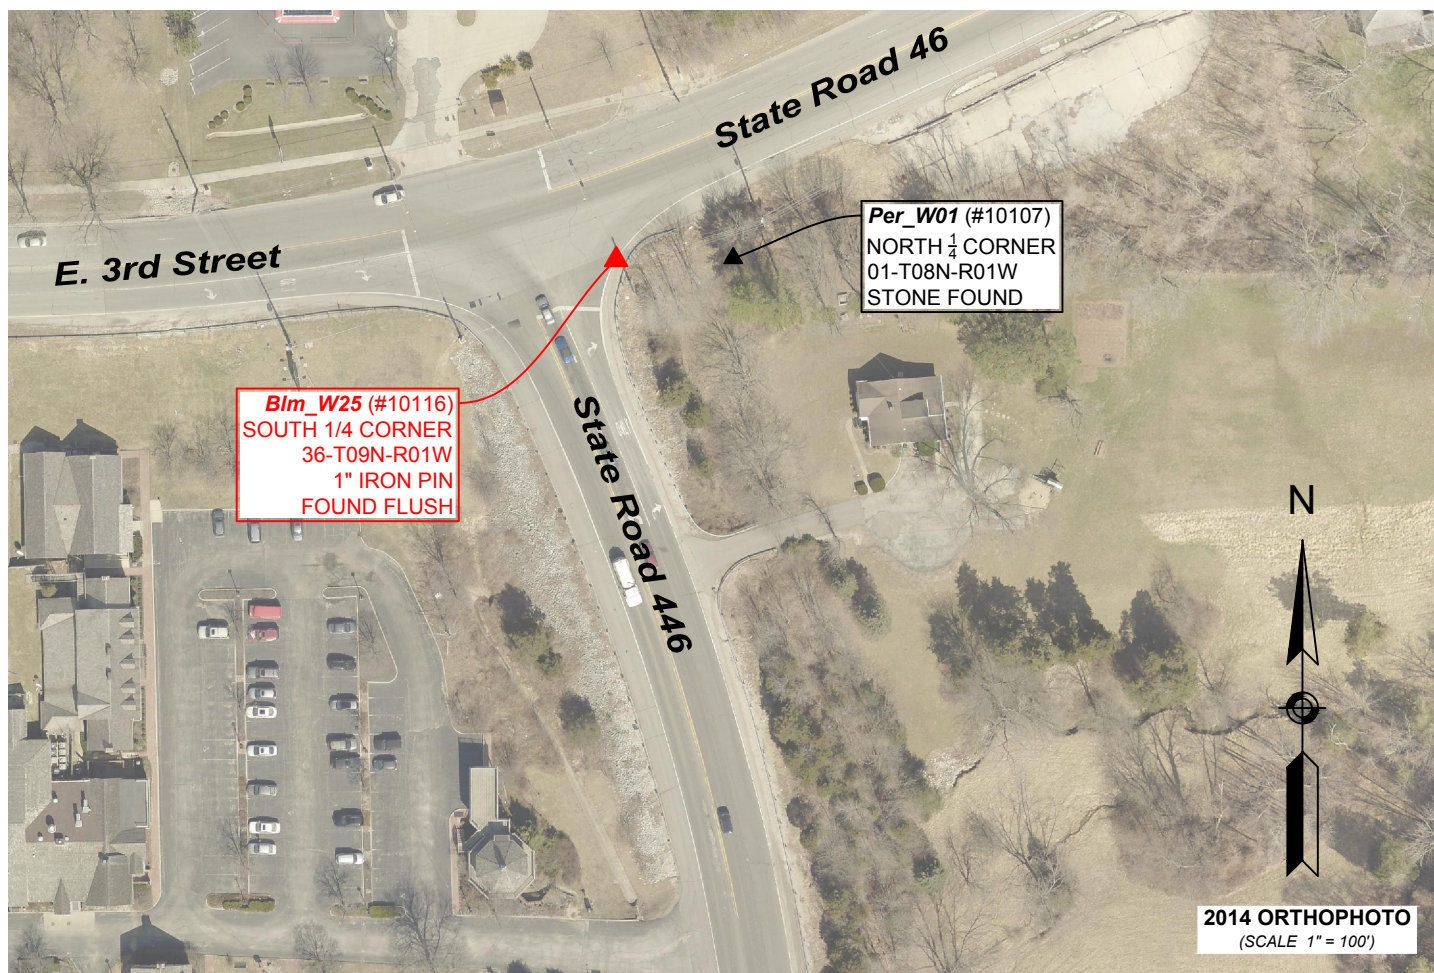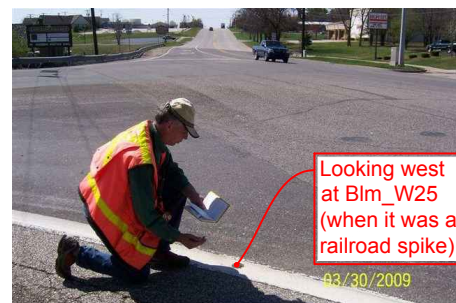


Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on 12/06/2018



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

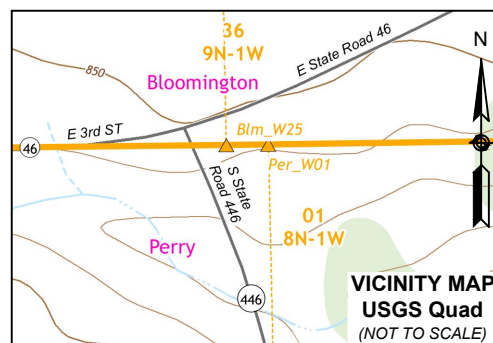

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
Blm_W25

South 1/4 Corner
Section 36- T09N-R01W
Bloomington Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 36

Township: 9 North


Range: 1 West

Corner ID: Blm W-25

Monument Description & Remarks: R.R. Spike flush with road. Survey Sign 5ft above ground at pt. B

References On File: Douglas R. Curry survey, Thornton Oil Corp. & Mark E. Hartzell (1991), Darren R. Norrington survey, Carroll & Donna Moore (2005), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 42 Page No. 35

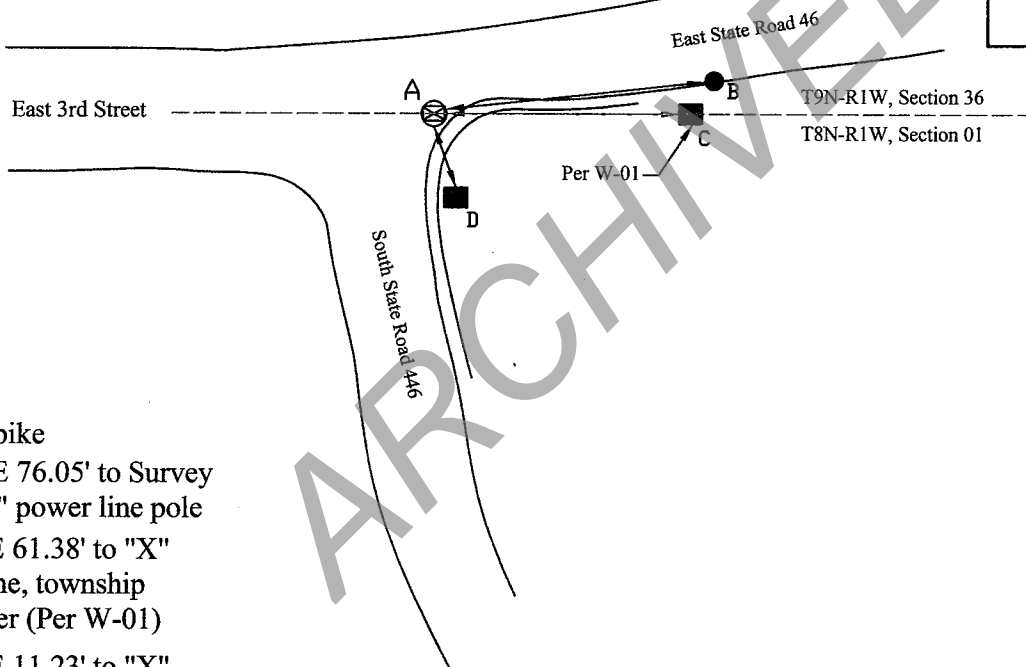

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 30th day of March, 2009.

Kevin P. Enright



Administered by the Monroe County Surveyor Review Board

Date: 5-12-2009